

digitalENGINEERING
CHANGE ORDERORIGINATOR G.B. Johnson
TEL EXT X4138 DATE 1/8/76
LOCATION ML 21-4/E10
COST CENTER NO. 301ECO NO. MD-11-DVKAC-A1/01
SHEET 1 OF 1
DATE RECEIVED 15-JAN-76
ISSUE DATE _____
FINAL RELEASE _____

PROBLEM With bit 11 set in the switch register to enable sub-test iterations, the program will not continue from the first iteration of test 64.

UNIT TO BE CHANGED

DVKACA

PRODUCT AFFECTED

LSI-11
PDP-11/03

CORRECTION

Corrected iteration set up code with patch.

TYPE OF ECO

 HARDWARE
 SOFTWARE
 PURCHASE SPEC.

BREAK-IN/EFFECTIVITY

This patch becomes effective immediately, but is only required when sub-test iterations are enabled with bit 11 of the software switch register. (Loc. 176)

FIELD SERVICE AFFECTED

 YES NO D, P, R DISTR. L.O. CODE

QUICK-CHECK

ZJVΦ-PB
ZJ215-RY

TEST

ITEM NO.	DOCUMENT/PART NO.	OLD REV	NEW REV	DESCRIPTION OF CHANGE/DISPOSITION OF MATERIAL		
				LOC.	FROM	TO
1.	MD-11-DVKAC	A	N/A	PATCH:		
				14400	000004	000240
				14402	000473	000240
				14404	012737	000240
				14406	014412	000240
				14410	000470	000240

APPROVAL SIGNATURE (TYPE NAME and SIGN)

PROJECT ENGR. Glenn Johnson / *Glenn Johnson*
ENG. MGR. W. Manter / *W. Manter*TEL. EXT. 4138 COST CENTER NO. 301
DISC. PROJ. NO. E20-08720 DATE 1/8/76COORD. NO. MC. 0167 REF. NO. _____

REVIEW SIGNATURES (SEE INSTRUCTIONS FOR APPLIC.)

FIELD SERVICE _____

DIAGNOSTIC ENGR. _____

Mfg.: W. Kellicker / *W. Kellicker*J. Curtis / *John Curtis*